



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME RANCHO MONTE VISTA MOBILEHOME PARK			REINSPECTION DATE Not Specified	INSPECTOR Casey Salazar	DATE 9/17/2015
LOCATION 15050 MONTE VISTA AV, CHINO HILLS, CA 91710			PERMIT EXPIRATION 6/30/2016	IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED	
TIME IN 1:10 PM	TIME OUT 1:40 PM	FACILITY ID FA0006998	RELATED ID PR0014036	PE 3620	

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




95

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

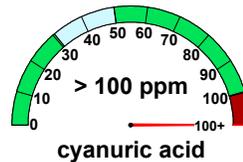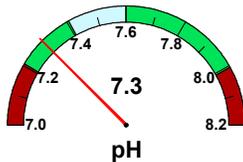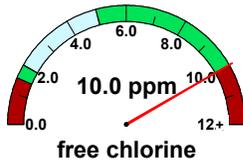

temperature (°F)	80.0
observed flow (gpm)	40
required flow (gpm)	197
volume (gal)	70,860
area (sq ft)	1,552
occupancy	76

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed cyanuric acid above 100 ppm. Lower cyanuric acid levels below 100 ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K528 Safety – Safety equipment

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed throw rope unable to span the maximum width at one section of pool. Provide longer throw rope.
	Not In Compliance	
	Violation Reference - HSC - 65540	

Violation Description: Except for spray grounds without standing water, the pool operator shall ensure that the following safety and first aid equipment is provided and maintained readily visible and available for use at the public pool at all times:

- (1) A 17-inch-minimum (exterior diameter) life ring with an attached throw rope with a minimum 3/16-inch diameter. The throw rope shall be of sufficient length to span the maximum width of the public pool and shall be stored in such a way as to prevent kinking or fouling.
- (2) A 12-foot-minimum fixed-length rescue pole with a permanently attached body hook. For spas, the length of the rescue pole shall be of sufficient length to effectuate rescue.

For public pools that exceed 75 feet in length or 50 feet in width, the pool operator shall provide a rescue pole and a life ring on at least two opposing sides of the public pool at centralized locations.

For public pools with lifeguard personnel on duty, the pool operator of each public pool area shall have the following additional safety equipment:

- (1) A Red Cross 10-Person Industrial First Aid Kit or the equivalent.
- (2) An operating telephone.
- (3) A backboard and head immobilizer.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME RANCHO MONTE VISTA MOBILEHOME PARK	DATE 9/17/2015
LOCATION 15050 MONTE VISTA AV, CHINO HILLS, CA 91710	INSPECTOR Casey Salazar

36K554 Equipment - Pressure/Vacuum gauge requirements

POINTS 1	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed clean start up pressure not marked on pressure gauge on filters. Mark clean start up pressure on gauge.
	Violation Reference - CCR 24 - 3125B.2	

Violation Description: A pressure and vacuum gauge shall be provided for each pump system. Each gauge shall have a scale range approximately 1 ¼ times the maximum anticipated working pressure or vacuum and shall be accurate within 2 percent of scale. The pressure gauge located on the filter shall be marked with the clean start up pressure reading.

36K562 Skimmers - Pool skimming systems

POINTS 1	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed weir gate missing from skimmer at deep end. Provide required skimmer equipment.
	Violation Reference - CCR - 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed hand rail at steps to be loose. Tighten handrail.
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

Pool inspection conducted

Signature(s) of Acknowledgement

NAME:
TITLE:

Total # of Images: 0