



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MARINA RESORT				REINSPECTION DATE Not Specified	INSPECTOR Tho Do	DATE 6/15/2016
LOCATION 40770 LAKEVIEW DR, BIG BEAR LAKE, CA 92315				PERMIT EXPIRATION 12/31/2016	IDENTIFIER: Pool	
TIME IN 1:28 PM	TIME OUT 2:32 PM	FACILITY ID FA0006773	RELATED ID PR0014169	PE 3620	SERVICE: 001 - INSPECTION - ROUTINE	
				RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE		
				ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

92
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

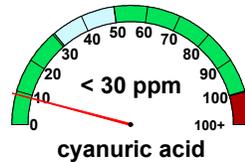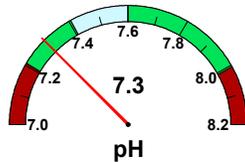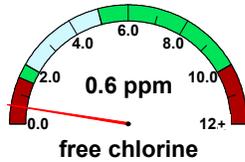

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	45
volume (gal)	17,820
area (sq ft)	No Data
occupancy	No Data

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K504 Water Quality – Non-Critical – Disinfectant level low

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Free chlorine level was measured at 0.6 ppm. Maintain free chlorine level at 1.0 ppm with without cyanuric acid, and 2.0 ppm with cyanuric acid at all times. The maximum chlorine level shall be 10.00 ppm. Operator was notified regarding low free chlorine level.
	Not In Compliance	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MARINA RESORT	DATE 6/15/2016
LOCATION 40770 LAKEVIEW DR, BIG BEAR LAKE, CA 92315	INSPECTOR Tho Do

36K527 Safety – Safety signs

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed safety sign with missing facility name and address, nearest emergency number, pool capacity. Provide safety signs with required information in clearly legible letters and numbers not less than 4 inches high. Operator was notified regarding the missing safety sign information.
	Not In Compliance	
	Violation Reference - CCR - 3120B	

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- ""NO DIVING"" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, ""WARNING: NO LIFEGUARD ON DUTY."" The sign also shall state in letters at least 1 inch high, ""Children under the age of 14 shall not use pool without a parent or adult guardian in attendance.""
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with ""CAUTION"" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, ""NO USE OF POOL ALLOWED AFTER DARK.""
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, ""KEEP GATE CLOSED"" or ""KEEP DOOR CLOSED"".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, ""CAUTION: WATER IS RECIRCULATED. DO NOT DRINK.""

36K538 Enclosure – Non-Critical – Fencing/Enclosure

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed fence bottom gap exceed 4-inch diameter sphere. Openings, holes or gap in closure shall not allow passage of a 4-inch diameter sphere. Operator was notified regarding the fence bottom gap.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

36K560 Equipment – Waste water

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed backwash line connected to waste line without 1 inch air gap. Discontinue this practice. Provide a minimum 1 inch air gap for backwash drain line. Operator was notified regarding the missing backwash air gap.
	Not In Compliance	
	Violation Reference - CCR - 3141B	

Violation Description: There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

The backwash from a diatomaceous earth filter shall discharge into a separation tank that has been installed to collect the waste diatomaceous earth mixture. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

36K565 Decking - Requirements

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed gap between deck area and pool coping. Provide and maintain a minimum continuous and unobstructed 4-foot wide deck area of concrete or like material. The 4-foot wide deck area shall be flush with top of pool coping. Repair or replace as necessary. Operator was notified regarding the gap between coping and deck area.
	Not In Compliance	
	Violation Reference - CCR 24 - 3114B	

Violation Description: A minimum continuous and unobstructed 4-foot wide (1219 mm) slip resistant, cleanable, nonabrasive deck area of concrete or like material shall be provided flush with the top of the pool coping extending completely around the pool, and the deck area shall further extend 4 feet (1219 mm) on both sides and rear of any diving board, fixed disabled access assistance device or slide and their appurtenances. The deck width shall be measured from the poolside edge of the coping lip.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MARINA RESORT	DATE 6/15/2016
LOCATION 40770 LAKEVIEW DR, BIG BEAR LAKE, CA 92315	INSPECTOR Tho Do

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed loose fence at the northwest side of pool. Maintain fence in good repair condition at all times. Repair or replace as necessary. Operator was notified regarding the loose fence.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed loose pool hand rails. Maintain all pool hand rails in good repair condition at all times. Repair or replace as necessary. Operator was notified regarding loose hand rail.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed non-functional flow meter in mechanical room. Maintain flow meter in good repair and working condition at all times. Operator was notified regarding the non-functional meter.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME: Robert Manning
TITLE:

Total # of Images: 0