



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>CIMARRON OAKS</b>		DATE <b>6/22/2015</b>	REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>6/30/2015</b>
LOCATION <b>1806 N VINEYARD AV, ONTARIO, CA 91764</b>			INSPECTOR <b>Shannon Johnson</b>	
MAILING ADDRESS <b>9267 HAVEN AVE STE 235, RANCHO CUCAMONGA CA 91730</b>			IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED	
TIME IN <b>11:32 AM</b>	TIME OUT <b>12:10 PM</b>	FACILITY ID <b>FA0008590</b>	RELATED ID <b>PR0014426</b>	PE <b>3623</b>




**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**93**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

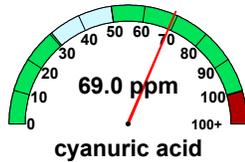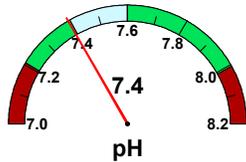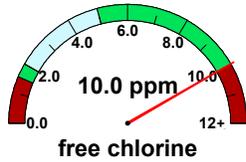

temperature (°F)	102.0
observed flow (gpm)	55
required flow (gpm)	47
volume (gal)	1,068
area (sq ft)	79
occupancy	8

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K527 Safety – Safety signs**

<b>POINTS</b> <b>1</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed no safety sign on the exterior side of all entrance gates leading into this pool/spa area.  Observed no spa capacity listed on the safety sign provided. This should be marked as 8 people.  Observed no safety sign with the phone number of the nearest emergency services other than 911 and the street address of this facility.
	Not In Compliance	
	Violation Reference - CCR - 3120B	

**Violation Description:** All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with "CAUTION" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."

**36K538 Enclosure – Non-Critical – Fencing/Enclosure**

<b>POINTS</b> <b>1</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed multiple areas of this pool/spa enclosure where there is a gap greater than four inches between the bottom of the enclosure to the ground below. From the westernmost entrance gate all the way around to the women's public restroom, there are gaps greater than four inches. These areas with these gaps must be eliminated. A follow up inspection will be conducted to ensure this violation in corrected.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

**Violation Description:** The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1 3/4 inches (44 mm) measured horizontally.



## Public Health

### Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CIMARRON OAKS	DATE 6/22/2015
LOCATION 1806 N VINEYARD AV, ONTARIO, CA 91764	INSPECTOR Shannon Johnson

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K556 Equipment – Plumbing labeled

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no directional symbols on piping within the equipment room.
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

#### 36K572 Maintenance – Pool shell cleanliness; slime and algae

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed a tile missing at the skimmer of this spa.
	Not In Compliance	
	Violation Reference - HSC - 65533	

**Violation Description:** (a) The pool operator shall maintain clean pool water while the public pool is in use. The pool operator shall not allow debris, including, but not limited to, floating scum, sputum, trash, or leaves, to accumulate in the public pool. The pool operator shall ensure that water levels are maintained and operated to remove such material continuously through the pool skimming system in accordance with section 3136B, Title 24, California Code of Regulations.

(b) The pool operator shall clean the bottom, sides, and other surfaces of the public pool as often as necessary to keep the bottom, sides, and public pool surfaces clean and free of slime and algae.

#### 36K576 Maintenance – Operation/Incident records

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no monthly cyanuric acid reading recorded on the daily records for review at this facility.
	Not In Compliance	
	Violation Reference - HSC - 65523	

**Violation Description:** The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.

#### 36K582 Maintenance - Public pool site maintenance

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the hand rail at the entrance to this spa to be loose.
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.



**Public Health**  
**Environmental Health Services**

www.SBCounty.gov

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>CIMARRON OAKS</b>	DATE <b>6/22/2015</b>
LOCATION <b>1806 N VINEYARD AV, ONTARIO, CA 91764</b>	INSPECTOR <b>Shannon Johnson</b>

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K589 Ancillary - Cleanliness/Supplies**

<b>POINTS</b>  <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no available paper towels within either public restroom.
	Not In Compliance	
	Violation Reference - HSC - 65551	

**Violation Description:** (a) The pool operator shall keep clean and free of slime, algae, litter, and vermin all ancillary facilities, including, but not limited to, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.  
 (b) Except for deck showers, all showers provided for pool users as required by Chapter 31B, Title 24, California Code of Regulations shall have soap in dispensers or containers.  
 (c) For toilet facilities, toilet tissue, handwashing soap, and paper towels or hot air blowers, shall be provided in permanently installed dispensing devices.  
 (d) The pool operator shall provide and maintain, in a clean and sanitary condition, a minimum of one waste receptacle in each toilet facility.  
 (e) Wooden slats, duckboards, and footbaths are prohibited.

**Overall Inspection Comments**

A follow up inspection will be conducted on 7-15-15 to ensure no gaps greater than four inches exist at the bottom of the enclosure to this pool/spa. Failure to achieve compliance at that time will result in a charged re-inspection.

**Signature(s) of Acknowledgement**

*NSC*

NAME:  
 TITLE:  
 Total # of Images: 0