



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CELAMONTE		DATE 8/4/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2016
LOCATION 17871 SHADY VIEW DR, CHINO HILLS, CA 91709			INSPECTOR Casey Salazar	
MAILING ADDRESS 25531 COMMERCENTER DR STE 100, LAKE FOREST CA 92630		<input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 03 - REINSPECTION REQUIRED		
TIME IN 10:18 AM	TIME OUT 11:00 AM	FACILITY ID FA0015564	RELATED ID PR0020692	PE 3620

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




91

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

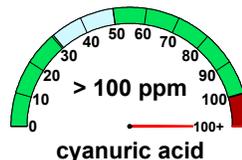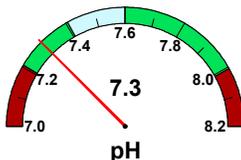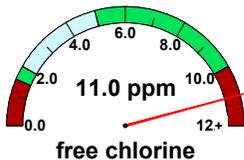

temperature (°F)	83.0
observed flow (gpm)	60
required flow (gpm)	93
volume (gal)	33,468
area (sq ft)	1,050
occupancy	53

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level



POINTS
5

Compliance Date: **Not Specified**
 Not In Compliance
 Violation Reference - HSC - 65529

Inspector Comments: Observed free chlorine levels above 10 ppm at three different areas of pool. Chlorine test strips verified concentration was between 10-50 ppm. Maintain free chlorine between 2-10 ppm.

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

36K518 Water Quality – Cyanuric acid concentration

POINTS
1

Compliance Date: **Not Specified**
 Not In Compliance
 Violation Reference - HSC - 65530

Inspector Comments: Observed cyanuric acid above 100 ppm. Lower cyanuric acid levels below 100 ppm.

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.



Public Health Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CELAMONTE	DATE 8/4/2015
LOCATION 17871 SHADY VIEW DR, CHINO HILLS, CA 91709	INSPECTOR Casey Salazar

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrainment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K562 Skimmers - Pool skimming systems

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed spring valves missing from skimmers. Provide required skimming equipment.
	Not In Compliance	
	Violation Reference - CCR - 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

36K572 Maintenance – Pool shell cleanliness; slime and algae

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed many small flies on surface of pool water. Ensure pool water is maintained clean and free of debris accumulation.
	Not In Compliance	
	Violation Reference - HSC - 65533	

Violation Description: (a) The pool operator shall maintain clean pool water while the public pool is in use. The pool operator shall not allow debris, including, but not limited to, floating scum, sputum, trash, or leaves, to accumulate in the public pool. The pool operator shall ensure that water levels are maintained and operated to remove such material continuously through the pool skimming system in accordance with section 3136B, Title 24, California Code of Regulations.

(b) The pool operator shall clean the bottom, sides, and other surfaces of the public pool as often as necessary to keep the bottom, sides, and public pool surfaces clean and free of slime and algae.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed hand rails at shallow end to be loose. Tighten hand rails.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K596 Permit - Public Pool Closure

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Permit is suspended and pool is closed due to high chlorine. Closure sign posted. Do not open without approval from San Bernardino County Environmental Health Services. When ready to open contact 800-442-2283.
	Not In Compliance	
	Violation Reference - HSC - 65545	

Description: A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

Overall Inspection Comments

Recommend to replace throw rope on life ring. Rope is becoming weak and beginning to disintegrate.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CELAMONTE	DATE 8/4/2015
LOCATION 17871 SHADY VIEW DR, CHINO HILLS, CA 91709	INSPECTOR Casey Salazar

SMA

NAME: Signature not available
TITLE:

Total # of Images: 0