



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>VILLA APTS</b>		DATE <b>7/29/2015</b>	REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>11/30/2014</b>
LOCATION <b>2791 N E ST, SAN BERNARDINO, CA 92405</b>			INSPECTOR <b>Anies Kondoker</b>	
MAILING ADDRESS <b>366 INLAND CENTER DR, SAN BERNARDINO CA 92408</b>			IDENTIFIER: Pool	
TIME IN <b>4:21 PM</b>	TIME OUT <b>5:22 PM</b>	FACILITY ID <b>FA0008810</b>	RELATED ID <b>PR0013630</b>	PE <b>3620</b>
			SERVICE: 001 - INSPECTION - ROUTINE	
			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU	
			ACTION: 13 - PERMIT SUSPENDE / FACILITY CLOSED	

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

**97**  
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

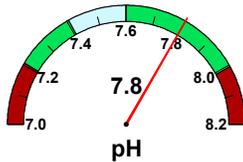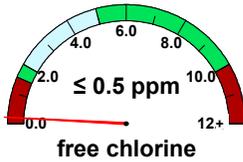

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K488 AB 1020 - Critical - Non-Compliant Pool/Spa**



**POINTS**  
**NA**

Compliance Date: **Not Specified**  
 Not In Compliance  
 Violation Reference - CCR 24 - 3162B

**Inspector Comments:** Observed StingL (safety vacuum release system) not functional. Ensure that the safety vacuum release system is fully functional.

**Violation Description:** Pool or spa is in violation of State Assembly Bill 1020, the Anti- Entrapment Devices and System Law for Public Swimming Pools. The compliance date of July 1, 2010 has passed. Compliance with AB 1020 is required. Health Permit is suspended, and the pool/spa is posted closed at this time. A drained pool/spa shall remain closed and secured until plans have been submitted to and approved by DEHS and all related construction finalized. Pool/spa shall meet all current health code requirements including compliance with AB 1020. If pool/spa is to be demolished, approval from Building and Safety must be obtained. Submit copy of finalized building permit to EHS for permit inactivation.

**36K504 Water Quality – Non-Critical – Disinfectant level low**

**POINTS**  
**1**

Compliance Date: **Not Specified**  
 Not In Compliance  
 Violation Reference - HSC - 65529

**Inspector Comments:** Measured free chlorine level below 2.0 ppm. Ensure to maintain free chlorine level between 2.0 ppm and 10 ppm.

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.



## Public Health

### Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME <b>VILLA APTS</b>	DATE <b>7/29/2015</b>
LOCATION <b>2791 N E ST, SAN BERNARDINO, CA 92405</b>	INSPECTOR <b>Anies Kondoker</b>

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K560 Equipment – Waste water

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no air gap between drain pipe of separation tank and floor drain. Provide an air gap.
	Not In Compliance	
	Violation Reference - CCR - 3141B	

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

The backwash from a diatomaceous earth filter shall discharge into a separation tank that has been installed to collect the waste diatomaceous earth mixture. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

#### 36K582 Maintenance - Public pool site maintenance

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed a sight glass install in the line between separation tank and floor drain. Install the sight glass in the line between filter and separation tank.  Observed non-functional flow meter. Repair/replace.  Observed missing anti-air lock device (float assembly) in skimmer. Replace.  Observed pool light not functional. Repair/replace.
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

#### 36K596 Permit - Public Pool Closure

<b>POINTS</b> <b>NA</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Pool permit is suspended due to non-functional safety vacuum release system. Call health dept prior opening.
	Not In Compliance	
	Violation Reference - HSC - 65545	

**Description:** A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

#### Overall Inspection Comments

No summary comments have been made for this inspection.

#### Signature(s) of Acknowledgement



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>VILLA APTS</b>	DATE <b>7/29/2015</b>
LOCATION <b>2791 N E ST, SAN BERNARDINO, CA 92405</b>	INSPECTOR <b>Anies Kondoker</b>

NAME:  
TITLE:

**Total # of Images: 0**