



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME UPLAND HILLS ESTATES		DATE 7/14/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 7/31/2015
LOCATION 1571 CYPRESS POINT DR, UPLAND, CA 91786			INSPECTOR Denise Martinez	
MAILING ADDRESS 8599 HAVEN AV STE 201, RANCHO CUCAMONGA CA 91730		<input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT IDENTIFIER: Pool- Cypress SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED		
TIME IN 1:17 PM	TIME OUT 1:55 PM	FACILITY ID FA0003443	RELATED ID PR0015575	PE 3620

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

98

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

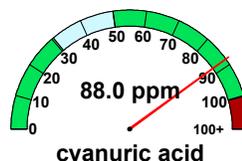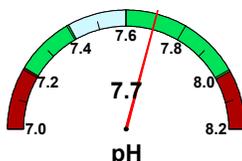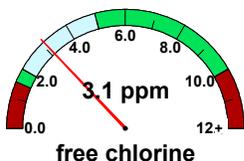

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	84
volume (gal)	30,064
area (sq ft)	1,009
occupancy	50

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K528 Safety – Safety equipment

POINTS
1

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - HSC - 65540

Inspector Comments: Observed rope missing from life ring. Provide rope securely attached to life ring as soon as possible.

Violation Description: Except for spray grounds without standing water, the pool operator shall ensure that the following safety and first aid equipment is provided and maintained readily visible and available for use at the public pool at all times:

- (1) A 17-inch-minimum (exterior diameter) life ring with an attached throw rope with a minimum 3/16-inch diameter. The throw rope shall be of sufficient length to span the maximum width of the public pool and shall be stored in such a way as to prevent kinking or fouling.
- (2) A 12-foot-minimum fixed-length rescue pole with a permanently attached body hook. For spas, the length of the rescue pole shall be of sufficient length to effectuate rescue.

For public pools that exceed 75 feet in length or 50 feet in width, the pool operator shall provide a rescue pole and a life ring on at least two opposing sides of the public pool at centralized locations.

For public pools with lifeguard personnel on duty, the pool operator of each public pool area shall have the following additional safety equipment:

- (1) A Red Cross 10-Person Industrial First Aid Kit or the equivalent.
- (2) An operating telephone.
- (3) A backboard and head immobilizer.

36K582 Maintenance - Public pool site maintenance

POINTS
1

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - HSC - 65535

Inspector Comments: Observed flow meter to be inoperable/stuck. Repair/replace flow meter for accurate flow readings.

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

Please address/correct all noted violations as soon as possible, within 2 weeks of this inspection.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME UPLAND HILLS ESTATES	DATE 7/14/2015
LOCATION 1571 CYPRESS POINT DR, UPLAND, CA 91786	INSPECTOR Denise Martinez

NAME: Signature not Available
TITLE:

Total # of Images: 0