



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME COLONY INN MOTEL		DATE 4/22/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2015
LOCATION 255 SPERRY DR, COLTON, CA 92324			INSPECTOR John Babalola	
MAILING ADDRESS 255 SPERRY DR, COLTON, CA 92324			IDENTIFIER: Pool	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 1:30 PM	TIME OUT 2:33 PM	FACILITY ID FA0008672	RELATED ID PR0015724	PE 3620
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	



**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**90**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

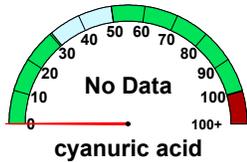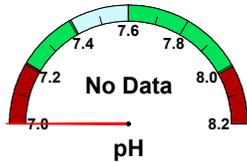

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	47
volume (gal)	17,220
area (sq ft)	574
occupancy	14

**36K444 Equipment - Recirculation Pump/Filter/Separation Tank**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> No flow direction labels observed in the equipment room. Provide the labels.
	Not In Compliance Violation Reference - HSC - 3120B, 3132B, 3141B	

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

**36K446 Equipment - Chlorinator/Heater/Jets**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> The automatic chlorinator is empty at the time of inspection. Refill with chlorine tablets.
	Not In Compliance Violation Reference - CCR - 65529, 65535, 3134B...	

**Violation Description:** Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.

**36K448 Equipment - Flow Meter**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Replace/repair the non-functional flow meter.
	Not In Compliance Violation Reference - CCR - 3125B	

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

**36K454 Maintenance - Cleanliness**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed yellow algae on the sides of the pool. Maintain free of algae.
	Not In Compliance Violation Reference - CCR - 65533	Debris buildup observed on the bottom of the pool. Maintain clean.

**Violation Description:** Floating scum, sputum or debris shall not be allowed to accumulate in the pool. The bottom and sides of the pool shall be cleaned as often as necessary to be kept in a clean condition. The sides and bottom of pools, decks and other surfaces shall be kept free of slime and algae.



**Public Health**  
**Environmental Health Services**

[www.SBCounty.gov](http://www.SBCounty.gov)

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>COLONY INN MOTEL</b>	DATE <b>4/22/2015</b>
LOCATION <b>255 SPERRY DR, COLTON, CA 92324</b>	INSPECTOR <b>John Babalola</b>

**36K460 Skimmers - Requirements**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Immediately discontinue the practice of keeping chlorine tablets inside the skimmer basket.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

**Overall Inspection Comments**

Observed pH = 7.2, chlorine = 5.0, cyanuric acid = 48, flow rate = 0.0.

**Signature(s) of Acknowledgement**

NAME: ken  
 TITLE: manger

Total # of Images: 0