



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME PACIFIC PALMS MOBILEHOME PARK		DATE 6/18/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION 2727 E PACIFIC ST, SAN BERNARDINO, CA 92410			INSPECTOR Sierra Clayborn	
MAILING ADDRESS PO BOX 11927, SANTA ANA CA 92711			IDENTIFIER: Back Pool	
TIME IN 1:40 PM			SERVICE: 001 - INSPECTION - ROUTINE	
TIME OUT 2:13 PM			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
FACILITY ID FA0008848			ACTION: 01 - NO FURTHER ACTION REQUIRED	
RELATED ID PR0015679			PE 3621	




RECREATIONAL HEALTH - Public Pool - Additional Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

90
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

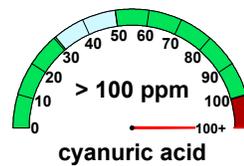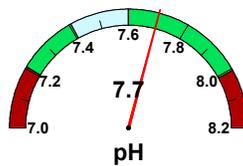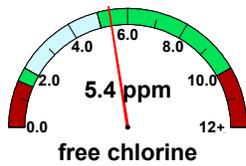

temperature (°F)	No Data
observed flow (gpm)	55
required flow (gpm)	42
volume (gal)	15,000
area (sq ft)	450
occupancy	22

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K524 Safety – Critical – Electrical hazards; GFCI ⚠ CRITICAL ⚠

POINTS 5	Compliance Date: Not Specified	Inspector Comments: Observed GFCI not attached to underwater pool light.
	Not In Compliance	Provide IMMEDIATELY.
	Violation Reference - HSC - 116049	

Violation Description: The design and installation of all underwater lighting systems, operating at more than 15 volts, supplied from a branch circuit either directly or by way of a transformer, shall be installed in a public swimming pool so that there is no shock hazard with any likely combination of fault conditions during normal use, and shall comply with both of the following requirements:

- An approved ground-fault circuit interrupter shall be installed in the branch circuit that supplies all fixtures operating at more than 15 volts.
- Only approved underwater lighting fixtures shall be used and no lighting fixtures shall be installed for operations at more than 150 volts between conductors.

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed cyanuric acid exceeding 100ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME PACIFIC PALMS MOBILEHOME PARK	DATE 6/18/2015
LOCATION 2727 E PACIFIC ST, SAN BERNARDINO, CA 92410	INSPECTOR Sierra Clayborn

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K527 Safety – Safety signs

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed the following pool safety signs missing: CPR Modified 911 sign in 1 inch font featuring the name and address of the pool facility and the phone number to the nearest emergency services
	Not In Compliance Violation Reference - CCR - 3120B	

Provide required safety signs as soon as possible, preferably before next routine inspection.

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) ""NO DIVING"" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, ""WARNING: NO LIFEGUARD ON DUTY."" The sign also shall state in letters at least 1 inch high, ""Children under the age of 14 shall not use pool without a parent or adult guardian in attendance.""
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- f) A warning sign for spa pools with ""CAUTION"" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, ""NO USE OF POOL ALLOWED AFTER DARK.""
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, ""KEEP GATE CLOSED"" or ""KEEP DOOR CLOSED"".
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, ""CAUTION: WATER IS RECIRCULATED. DO NOT DRINK.""

36K556 Equipment – Plumbing labeled

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Provide labels for direction of flow of water through recirculation system on plumbing by next routine inspection.
	Not In Compliance Violation Reference - CCR 24 - 3120B	

Violation Description: The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

36K562 Skimmers - Pool skimming systems

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed weir gate and float assembly missing and skimming basket broken. Replace.
	Not In Compliance Violation Reference - CCR - 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.



Public Health
Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME PACIFIC PALMS MOBILEHOME PARK	DATE 6/18/2015
LOCATION 2727 E PACIFIC ST, SAN BERNARDINO, CA 92410	INSPECTOR Sierra Clayborn

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K576 Maintenance – Operation/Incident records

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed no records available for daily water chemistry testing.
	Not In Compliance	
	Violation Reference - HSC - 65523	<u>Water chemistry must be tested and recorded daily.</u>

Violation Description: The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME:
 TITLE:

Total # of Images: 0