



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME VILLA DEL LAGO		DATE 8/24/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 5/31/2016
LOCATION 2037 VILLA DEL LAGO DR, CHINO HILLS, CA 91710			INSPECTOR Casey Salazar	
MAILING ADDRESS 1275 E CENTER CT DR, COVINA CA 91724			IDENTIFIER: Pool	
TIME IN 3:25 PM	TIME OUT 4:14 PM	FACILITY ID FA0004090	RELATED ID PR0015362	PE 3620
			SERVICE: 001 - INSPECTION - ROUTINE	
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




98

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

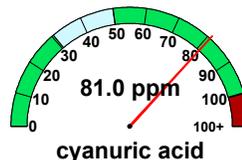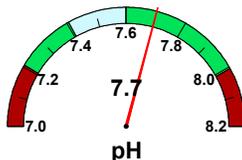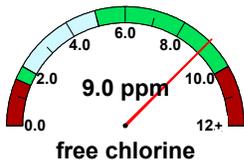

temperature (°F)	No Data
observed flow (gpm)	140
required flow (gpm)	93
volume (gal)	33,660
area (sq ft)	900
occupancy	45

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:
 1. Meet the latest ANSI/APSP-16 performance standard
 2. Be rated for the maximum designed flow-rate of the pump
 Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K538 Enclosure – Non-Critical – Fencing/Enclosure

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed bottom railing of fence by BBQ pit rusted through and detached from grounded post. Repair/replace fencing.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¾ inches (44 mm) measured horizontally.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed drinking fountain unable to provide water at a strong enough pressure to allow person to drink. If provided, ensure water fountain is well maintained and able to provide accessible drinking water.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Observed throw rope provided beginning to deteriorate from sun exposure. Provide new throw rope.

Observed outer 2 lights unable to turn on. Repair/replace lights and ensure GFCI is able to turn lights off when tested and turn lights back on when reset.

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

Pool inspection conducted

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME VILLA DEL LAGO	DATE 8/24/2015
LOCATION 2037 VILLA DEL LAGO DR, CHINO HILLS, CA 91710	INSPECTOR Casey Salazar

SVA

NAME:
TITLE:

Total # of Images: 0