



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME AMADOR ON ROUTE 66		DATE 7/10/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 8/31/2014
LOCATION 8090 CORNWALL, RANCHO CUCAMONGA, CA 91739			INSPECTOR Nick Thalasinios	
MAILING ADDRESS 1760 CALIFORNIA AV STE 101, CORONA CA 92881			IDENTIFIER: Spa	
TIME IN 3:45 PM	TIME OUT 4:27 PM	FACILITY ID FA0015706	RELATED ID PR0020872	PE 3623
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED	

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility


Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

98

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

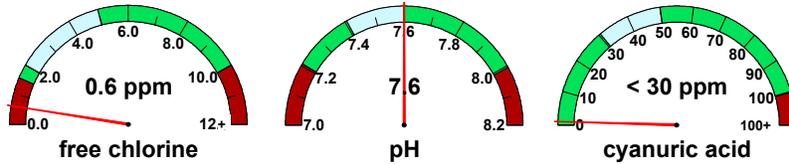

temperature (°F)	104.0
observed flow (gpm)	No Data
required flow (gpm)	28
volume (gal)	859
area (sq ft)	50
occupancy	5

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K504 Water Quality – Non-Critical – Disinfectant level low

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed less than 3.0 ppm of free chlorine; The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine.
	Not In Compliance	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

36K538 Enclosure – Non-Critical – Fencing/Enclosure

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed eight (8) climbable trees along the outside perimeter of the fence; No planters or other structures that can be climbed shall be permitted within five (5) feet (1524 mm) of the outside of the pool enclosure or within a five (5) foot (1524 mm) arc.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

Overall Inspection Comments

Spa Pool

Facility has one (1) week to remove the trees from the outside perimeter of the fence.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME AMADOR ON ROUTE 66	DATE 7/10/2015
LOCATION 8090 CORNWALL , RANCHO CUCAMONGA, CA 91739	INSPECTOR Nick Thalasinis

NAME:
TITLE:

Total # of Images: 0