



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>MOUNTAIN PARK TOWNHOUSES</b>		DATE <b>7/30/2015</b>	REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>2/28/2016</b>
LOCATION <b>1380 W 48TH ST, SAN BERNARDINO, CA 92407</b>			INSPECTOR <b>Yvette Velasco</b>	
MAILING ADDRESS <b>9267 HAVEN AV STE 220, RANCHO CUCAMONGA CA 91730</b>			IDENTIFIER: Spa	
TIME IN <b>1:25 PM</b>			SERVICE: 001 - INSPECTION - ROUTINE	
TIME OUT <b>1:42 PM</b>			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU	
FACILITY ID <b>FA0005708</b>			ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	
RELATED ID <b>PR0013817</b>			PE <b>3623</b>	

**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



**95**

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

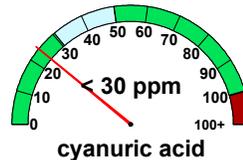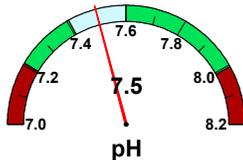

temperature (°F)	86.0
observed flow (gpm)	No Data
required flow (gpm)	43
volume (gal)	1,315
area (sq ft)	No Data
occupancy	7

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:  
1. Meet the latest ANSI/APSP-16 performance standard  
2. Be rated for the maximum designed flow-rate of the pump  
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K529 Safety – Critical – Main drain suction hazards** ⚠️ CRITICAL ⚠️

<b>POINTS</b>  <b>5</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed one suction cover lose and one suction cover missing in the spa.
	<b>Not In Compliance</b>	
	Violation Reference - CCR - 3137B, 116064	Ensure to to replace covers and ensure they are properly intact.

**Violation Description:** All suction outlets shall be equipped with suction fittings that meet the most recent ANSI/APSP performance standard.

All public wading pool suction outlets shall be covered with antivortex grates or similar protective devices. All suction outlets shall be covered with grates or antivortex plates that cannot be removed except with the use of tools. Slots or openings in the grates or similar protective devices shall be of a shape, area, and arrangement that would prevent physical entrapment and would not pose any suction hazard to bathers.

**36K596 Permit - Public Pool Closure**

<b>POINTS</b>  <b>NA</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Due to missing in lose suction cover the spa is closed at this time.
	<b>Not In Compliance</b>	
	Violation Reference - HSC - 65545	Please contact the Division of Environmental Health at 1-800-442-2283 when the pool is ready to be reopened.

**Description:** A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME MOUNTAIN PARK TOWNHOUSES	DATE 7/30/2015
LOCATION 1380 W 48TH ST, SAN BERNARDINO, CA 92407	INSPECTOR Yvette Velasco

NAME:  
TITLE:

Total # of Images: 0