



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME VINTAGE TOWNEHOMES		DATE 7/7/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION BAKER & FOOTHILL, RANCHO CUCAMONGA, CA 91730			INSPECTOR Shannon Johnson	
MAILING ADDRESS 1275 CENTER COURT DR, COVINA CA 91724			IDENTIFIER: Main Pool, with Spa	
<input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 3:51 PM	TIME OUT 4:29 PM	FACILITY ID FA0004636	RELATED ID PR0015259	PE 3620
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**93**

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

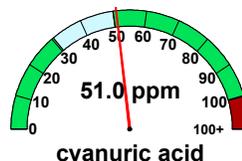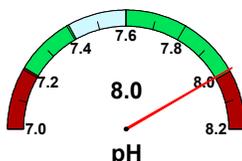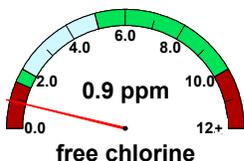

temperature (°F)	83.0
observed flow (gpm)	55
required flow (gpm)	80
volume (gal)	28,885
area (sq ft)	968
occupancy	48

**IMPORTANT: Replacement of Suction Outlet Covers**

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K504 Water Quality – Non-Critical – Disinfectant level low**

**POINTS**  
**1**

Compliance Date: Not Specified  
 Not In Compliance  
 Violation Reference - HSC - 65529

**Inspector Comments:** Observed the measured free chlorine level within the pool water to be 0.5

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

**36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8**

**POINTS**  
**1**

Compliance Date: Not Specified  
 Not In Compliance  
 Violation Reference - HSC - 65530

**Inspector Comments:** Observed the measured pH within the pool water to be 8

**Violation Description:** The pool operator shall maintain public pool water at pH 7.2 to 7.8.



## Public Health

### Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME <b>VINTAGE TOWNEHOMES</b>	DATE <b>7/7/2015</b>
LOCATION <b>BAKER &amp; FOOTHILL, RANCHO CUCAMONGA, CA 91730</b>	INSPECTOR <b>Shannon Johnson</b>

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K528 Safety – Safety equipment

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no throw rope connected to the life ring.
	Not In Compliance Violation Reference - HSC - 65540	

**Violation Description:** Except for spray grounds without standing water, the pool operator shall ensure that the following safety and first aid equipment is provided and maintained readily visible and available for use at the public pool at all times:

- (1) A 17-inch-minimum (exterior diameter) life ring with an attached throw rope with a minimum 3/16-inch diameter. The throw rope shall be of sufficient length to span the maximum width of the public pool and shall be stored in such a way as to prevent kinking or fouling.
- (2) A 12-foot-minimum fixed-length rescue pole with a permanently attached body hook. For spas, the length of the rescue pole shall be of sufficient length to effectuate rescue.

For public pools that exceed 75 feet in length or 50 feet in width, the pool operator shall provide a rescue pole and a life ring on at least two opposing sides of the public pool at centralized locations.

For public pools with lifeguard personnel on duty, the pool operator of each public pool area shall have the following additional safety equipment:

- (1) A Red Cross 10-Person Industrial First Aid Kit or the equivalent.
- (2) An operating telephone.
- (3) A backboard and head immobilizer.

#### 36K556 Equipment – Plumbing labeled

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no directional symbols on piping within the equipment room.
	Not In Compliance Violation Reference - CCR 24 - 3120B	

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

#### 36K562 Skimmers - Pool skimming systems

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no weir within either skimmer and no float assembly within the SE skimmer.
	Not In Compliance Violation Reference - CCR - 3136B	

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

#### 36K576 Maintenance – Operation/Incident records

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no monthly cyanuric acid reading recorded on the daily records for review.
	Not In Compliance Violation Reference - HSC - 65523	

**Violation Description:** The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>VINTAGE TOWNEHOMES</b>	DATE <b>7/7/2015</b>
LOCATION <b>BAKER &amp; FOOTHILL, RANCHO CUCAMONGA, CA 91730</b>	INSPECTOR <b>Shannon Johnson</b>

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K582 Maintenance - Public pool site maintenance**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no site glass on the separation tank portion of this recirculation system.
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**

NAME:  
 TITLE:

Total # of Images: 0