



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME GATES OF SPAIN MHP			DATE 9/2/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION 7501 PALM AV, YUCCA VALLEY, CA 92284			INSPECTOR Marilyn Krichbaum		
MAILING ADDRESS 7501 PALM AV, YUCCA VALLEY, CA 92284			IDENTIFIER: Pool		
TIME IN 10:21 AM	TIME OUT 10:55 AM	FACILITY ID FA0007183	RELATED ID PR0014714	PE 3620	SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



93

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

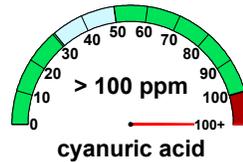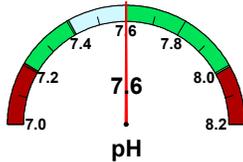

temperature (°F)	No Data
observed flow (gpm)	50
required flow (gpm)	No Data
volume (gal)	27,000
area (sq ft)	No Data
occupancy	20

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K544 Equipment – Critical – Water treatment system operation

CRITICAL

POINTS 5	Compliance Date: Not Specified	Inspector Comments: Observed that the pool recirculation system shuts off when the pool is still open for use. The pool recirculation system must be operating before the pool is open, while open for use, and then sometime after it is closed.
	Not In Compliance	
	Violation Reference - HSC - 65525	

Violation Description: The pool operator shall operate pumps, filters, disinfectant and chemical feeders, flow indicators, gauges, recirculation systems, disinfection systems, and all parts of the water treatment system whenever the public pool is available for use, and at such additional times and periods as may be necessary to maintain clean pool water, clear pool water, and the disinfection standards required in section 65529 [Health and Safety Code].

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed a cyanuric acid level greater than 100ppm. Lower the cyanuric acid level so that it is below 100ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Secure the loose handrail. Replace the missing weir gate.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

No summary comments have been made for this inspection.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME GATES OF SPAIN MHP	DATE 9/2/2015
LOCATION 7501 PALM AV, YUCCA VALLEY, CA 92284	INSPECTOR Marilyn Krichbaum

Signature(s) of Acknowledgement

A handwritten signature in blue ink that reads "CHill".

NAME: Christina Hill

TITLE:

Total # of Images: 0