



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>HARRIS PLACE</b>			DATE <b>7/30/2015</b>	REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>6/30/2016</b>
LOCATION <b>451 E RIVERSIDE DR, ONTARIO, CA 91761</b>				INSPECTOR <b>Veronica Martinez</b>	
MAILING ADDRESS <b>451 E RIVERSIDE DR, ONTARIO, CA 91761</b>				IDENTIFIER: Pool	
TIME IN <b>11:12 AM</b>	TIME OUT <b>11:52 AM</b>	FACILITY ID <b>FA0004815</b>	RELATED ID <b>PR0015221</b>	PE <b>3620</b>	SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




**97**

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

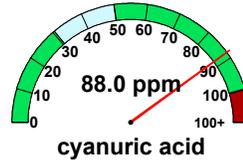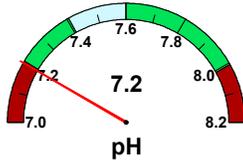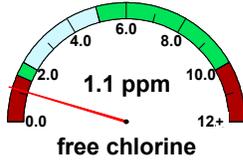

temperature (°F)	No Data
observed flow (gpm)	80
required flow (gpm)	61
volume (gal)	22,000
area (sq ft)	890
occupancy	42

**IMPORTANT: Replacement of Suction Outlet Covers**

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K504 Water Quality – Non-Critical – Disinfectant level low**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed free chlorine residual measuring 1.14 ppm. Maintain free chlorine residual between 2.0 ppm and 10.0 ppm in the presence of cyanuric acid.
	Not In Compliance	
	Violation Reference - HSC - 65529	

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

**36K560 Equipment – Waste water**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no air gap for backwash line into sanitary sewer. Provide a minimum of a 1" vertical space between backwash pipe and sanitary sewer to prevent possible back flow.
	Not In Compliance	
	Violation Reference - CCR - 3141B	

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

The backwash from a diatomaceous earth filter shall discharge into a separation tank that has been installed to collect the waste diatomaceous earth mixture. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.



## Public Health

### Environmental Health Services

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME <b>HARRIS PLACE</b>	DATE <b>7/30/2015</b>
LOCATION <b>451 E RIVERSIDE DR, ONTARIO, CA 91761</b>	INSPECTOR <b>Veronica Martinez</b>

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K597 Construction - Pool shell tiles and surface

**POINTS**  
**1**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 3108B

#### Inspector Comments:

Observed deterioration of plaster on walls and steps. Repair and maintain smooth and easily cleanable surface.

**Violation Description:** The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing and cleaning procedures. The interior pool finish shall completely line the pool to the tile lines, coping, or cantilevered deck.

The finish color shall be white except for the following which shall be of contrasting color:

1. Lane and other required pool markings described in Section 3110B of the California Code of Regulations; and
2. The top surface edges of benches in spa pools; and
3. The edge of pool steps; and
4. Tiles installed at the waterline; and
5. Tiles installed at the 4 1/2-foot (1372 mm) depth line.

#### Overall Inspection Comments

No summary comments have been made for this inspection.

#### Signature(s) of Acknowledgement

A handwritten signature in blue ink that reads "Ramona Ramsey".

NAME: Ramona Ramsey  
TITLE:

Total # of Images: 0