



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME NEW DESERT VISTA APTS		DATE 7/21/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 7/31/2015
LOCATION 2301 MURIEL CR, BARSTOW, CA 92311			INSPECTOR Michelle Saltis	
MAILING ADDRESS 2301 MURIEL CR, BARSTOW, CA 92311			IDENTIFIER: Spa by Laundry	
<input checked="" type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input type="checkbox"/> ACCOUNT			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 4:47 PM	TIME OUT 5:15 PM	FACILITY ID FA0006606	RELATED ID PR0015905	PE 3623
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	

**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



**95**

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

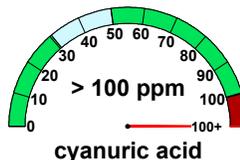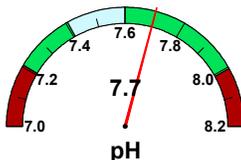

temperature (°F)	102.0
observed flow (gpm)	No Data
required flow (gpm)	50
volume (gal)	1,500
area (sq ft)	78
occupancy	7

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K518 Water Quality – Cyanuric acid concentration**

<b>POINTS</b>  <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Maintain cyanuric acid at or below 100ppm in water.
	Not In Compliance	Observed cyanuric acid measuring at or above 111ppm.
	Violation Reference - HSC - 65530	

**Violation Description:** The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.



## Public Health

### Environmental Health Services

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME <b>NEW DESERT VISTA APTS</b>	DATE <b>7/21/2015</b>
LOCATION <b>2301 MURIEL CR, BARSTOW, CA 92311</b>	INSPECTOR <b>Michelle Saltis</b>

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K527 Safety – Safety signs

**POINTS**  
**1**

**Compliance Date: Not Specified**  
**Not In Compliance**  
**Violation Reference - CCR - 3120B**

**Inspector Comments:** Immediately provide nearest emergency center contact phone number and site location address on safety sign.  
Did not observe nearest emergency center contact phone number and site location address posted on safety sign.

Provide "Keep gate closed," diarrhea sign, and maximum capacity signs.  
Did not observe "Keep gate closed," diarrhea sign, and maximum capacity signs posted.

**Violation Description:** All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) ""NO DIVING"" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, ""WARNING: NO LIFEGUARD ON DUTY."" The sign also shall state in letters at least 1 inch high, ""Children under the age of 14 shall not use pool without a parent or adult guardian in attendance.""
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- f) A warning sign for spa pools with ""CAUTION"" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, ""NO USE OF POOL ALLOWED AFTER DARK.""
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, ""KEEP GATE CLOSED"" or ""KEEP DOOR CLOSED"".
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, ""CAUTION: WATER IS RECIRCULATED. DO NOT DRINK.""

#### 36K538 Enclosure – Non-Critical – Fencing/Enclosure

**POINTS**  
**1**

**Compliance Date: Not Specified**  
**Not In Compliance**  
**Violation Reference - CCR - 3119B**

**Inspector Comments:** Repair fencing on north east side of pool/spa.

Observed fencing loose. A reinspection will be conducted within two weeks to follow up on compliance. Failure to do so may result in a charged reinspection. Contact Environmental Health at 800-442-2283 for a reinspection, questions and/or concerns.

**Violation Description:** The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¾ inches (44 mm) measured horizontally.

#### 36K556 Equipment – Plumbing labeled

**POINTS**  
**1**

**Compliance Date: Not Specified**  
**Not In Compliance**  
**Violation Reference - CCR 24 - 3120B**

**Inspector Comments:** Provide direction arrows to show the flow of recirculation of the water.

Did not observe directional symbols on piping.

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>NEW DESERT VISTA APTS</b>	DATE <b>7/21/2015</b>
LOCATION <b>2301 MURIEL CR, BARSTOW, CA 92311</b>	INSPECTOR <b>Michelle Saltis</b>

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K584 Maintenance - Operating procedures/Manufacturers' instructions**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Repair/replace flow meter.
	Not In Compliance	Observed flow meter stuck.
Violation Reference - HSC - 65521		

**Violation Description:** The pool operator shall maintain pool operating procedures at the public pool site for use by the pool operator and for inspection by the enforcing agent.  
 The pool operator shall maintain manufacturers' instructions for the operation and maintenance for all mechanical and electrical equipment and water treatment systems at the public pool site for use by the pool operator and for inspection by the enforcing agent.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**

NAME: tammy hoffman  
 TITLE: asst manager

Total # of Images: 0