



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME RANCHO PINO VERDE		DATE 6/2/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 9/30/2015
LOCATION 11981 MIDWAY AV, LUCERNE VALLEY, CA 92356			INSPECTOR Michelle Saltis	
MAILING ADDRESS 11981 MIDWAY AV, LUCERNE VALLEY, CA 92356			IDENTIFIER: Spa	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 11:46 AM	TIME OUT 12:42 PM	FACILITY ID FA0011577	RELATED ID PR0013690	PE 3623
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	




**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**97**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

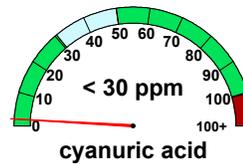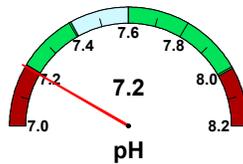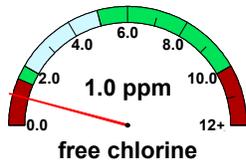

temperature (°F)	No Data
observed flow (gpm)	70
required flow (gpm)	67
volume (gal)	2,000
area (sq ft)	70
occupancy	7

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:  
1. Meet the latest ANSI/APSP-16 performance standard  
2. Be rated for the maximum designed flow-rate of the pump  
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K526 Safety - Emergency shut-off switch**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Immediately provide a sign for the safety turn off switch for the spa.
	Not In Compliance Violation Reference - CCR 24 - 3138B.5	Observed missing.

**Violation Description:** A clearly labeled emergency shut off switch for the control of both the recirculation system and the aeration and/or jet system shall be installed adjacent to the spa pool.

**36K556 Equipment – Plumbing labeled**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Ensure to make pipes with clear directional arrows indicating flow.
	Not In Compliance Violation Reference - CCR 24 - 3120B	Observed no visible arrows for directional flow on pipes.

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

**36K560 Equipment – Waste water**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Ensure to provide a 1 inch air gap from the pipe to the sewer connection.
	Not In Compliance Violation Reference - CCR - 3141B	Observed pipe from pool waste water directly connected to the sewer drain.

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>RANCHO PINO VERDE</b>	DATE <b>6/2/2015</b>
LOCATION <b>11981 MIDWAY AV, LUCERNE VALLEY, CA 92356</b>	INSPECTOR <b>Michelle Saltis</b>

A handwritten signature in blue ink that reads "Kevin Mangold".

NAME: Kevin Mangold  
TITLE: Program Director

Total # of Images: 0