



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME BEST WESTERN BIG BEAR CHATEAU				REINSPECTION DATE Not Specified	INSPECTOR Sierra Clayborn	DATE 10/27/2015
LOCATION 42200 MOONRIDGE RD, BIG BEAR LAKE, CA 92315				PERMIT EXPIRATION 11/30/2015	IDENTIFIER: Spa	
TIME IN 3:44 PM	TIME OUT 4:09 PM	FACILITY ID FA0005560	RELATED ID PR0015803	PE 3623	SERVICE: 001 - INSPECTION - ROUTINE	
				RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU		
				ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED		

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).




92

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

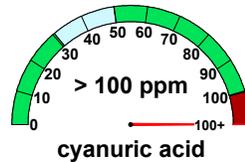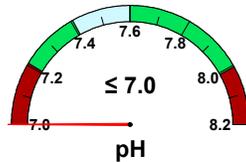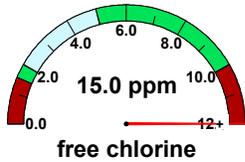

temperature (°F)	103.0
observed flow (gpm)	70
required flow (gpm)	25
volume (gal)	750
area (sq ft)	50
occupancy	5

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K995 Permit - Suspension **⚠ CRITICAL ⚠**

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Spa permit suspended due to excessive free chlorine concentration.
	Not In Compliance	
	Violation Reference - HSC	

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K502 Water Quality - Critical – Disinfectant level **⚠ CRITICAL ⚠**

POINTS 5	Compliance Date: Not Specified	Inspector Comments: Observed free chlorine exceeding 10ppm. Maintain spa free chlorine between 3.0ppm and 10ppm.
	Not In Compliance	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME BEST WESTERN BIG BEAR CHATEAU	DATE 10/27/2015
LOCATION 42200 MOONRIDGE RD, BIG BEAR LAKE, CA 92315	INSPECTOR Sierra Clayborn

36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed pH at 7.0.
	Not In Compliance	Maintain pH between 7.2 and 7.8.
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed cyanuric acid exceeding 100ppm.
	Not In Compliance	Maintain cyanuric acid below 100ppm.
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K572 Maintenance – Pool shell cleanliness; slime and algae

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed spa shell stained turquoise and excessive foam when jets are turned on.
	Not In Compliance	Ensure to maintain spa shell in good condition. Reduce/eliminate foam.
	Violation Reference - HSC - 65533	

Violation Description: (a) The pool operator shall maintain clean pool water while the public pool is in use. The pool operator shall not allow debris, including, but not limited to, floating scum, sputum, trash, or leaves, to accumulate in the public pool. The pool operator shall ensure that water levels are maintained and operated to remove such material continuously through the pool skimming system in accordance with section 3136B, Title 24, California Code of Regulations.

(b) The pool operator shall clean the bottom, sides, and other surfaces of the public pool as often as necessary to keep the bottom, sides, and public pool surfaces clean and free of slime and algae.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME:
TITLE:

Total # of Images: 0