



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MULBERRY PLACE		DATE 6/11/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 8/31/2015
LOCATION ARROW ROUTE / VINEYARD , RANCHO CUCAMONGA, CA 91730			INSPECTOR Shannon Johnson	
MAILING ADDRESS PO BOX 5022, UPLAND CA 91785			IDENTIFIER: Pool	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 8:57 AM	TIME OUT 9:40 AM	FACILITY ID FA0006099	RELATED ID PR0014903	PE 3620
			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU	
			ACTION: 03 - REINSPECTION REQUIRED	




RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

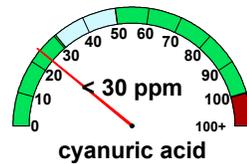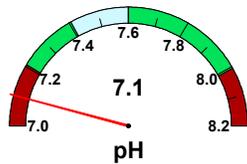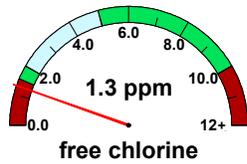

temperature (°F)	90.0
observed flow (gpm)	70
required flow (gpm)	45
volume (gal)	22,000
area (sq ft)	740
occupancy	37

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:
1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed the measured pH within this pool to be 7.1
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K527 Safety – Safety signs

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed no safety sign at this facility with the number of the nearest emergency services other than 911 or a safety sign with the street address of the pool facility.
	Not In Compliance	
	Violation Reference - CCR - 3120B	

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- f) A warning sign for spa pools with "CAUTION" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."



Public Health

Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MULBERRY PLACE	DATE 6/11/2015
LOCATION ARROW ROUTE / VINEYARD , RANCHO CUCAMONGA, CA 91730	INSPECTOR Shannon Johnson

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K538 Enclosure – Non-Critical – Fencing/Enclosure

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed multiple areas of this enclosure with gaps greater than four inches between the bottom of the enclosure and the ground below. All gaps greater than four inches at any place of this enclosure must be eliminated and maintained as needed. A follow up inspection will be conducted to ensure compliance regarding this violation.
	Not In Compliance Violation Reference - CCR - 3119B	

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

36K556 Equipment – Plumbing labeled

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed no directional symbols on piping within the equipment room.
	Not In Compliance Violation Reference - CCR 24 - 3120B	

Violation Description: The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

36K576 Maintenance – Operation/Incident records

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed no monthly cyanuric acid concentration reading listed on the daily records.
	Not In Compliance Violation Reference - HSC - 65523	

Violation Description: The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed the hand rails to be loose at the deep end of this pool. Observed an accumulation of DE and debris on the floor of the equipment room.
	Not In Compliance Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

A follow up inspection will be conducted on 7-2-15 to ensure that all gaps greater than four inches at the bottom of the enclosure for this facility have been eliminated. Failure to achieve compliance by this date will result in a charged re-inspection.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MULBERRY PLACE	DATE 6/11/2015
LOCATION ARROW ROUTE / VINEYARD , RANCHO CUCAMONGA, CA 91730	INSPECTOR Shannon Johnson

NSE

NAME:
TITLE:

Total # of Images: 0