



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME NOVA VILLAGE GREEN		DATE 5/6/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 8/31/2015
LOCATION 2122 W CHESTNUT ST, SAN BERNARDINO, CA 92410			INSPECTOR John Babalola	
MAILING ADDRESS 2122 W CHESTNUT ST, SAN BERNARDINO, CA 92410			IDENTIFIER: Pool	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 4:06 PM	TIME OUT 4:46 PM	FACILITY ID FA0008825	RELATED ID PR0016009	PE 3620
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	



RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

96
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

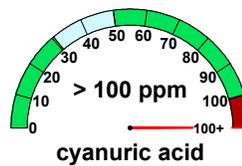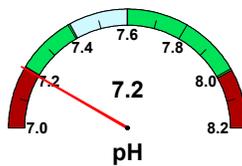

temperature (°F)	No Data
observed flow (gpm)	0
required flow (gpm)	132
volume (gal)	47,520
area (sq ft)	1,152
occupancy	57

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: The cyanuric acid level is observed above 100 ppm. Maintain below 100 ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K556 Equipment – Plumbing labeled

POINTS 1	Compliance Date: Not Specified	Inspector Comments: No flow direction labels observed in the equipment room. Provide labels.
	Not In Compliance	
	Violation Reference - CCR - 3120B	

Violation Description: The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Replace the missing skimmer weir gates.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Repair the non-functional flow meter.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME NOVA VILLAGE GREEN	DATE 5/6/2015
LOCATION 2122 W CHESTNUT ST, SAN BERNARDINO, CA 92410	INSPECTOR John Babalola

A handwritten signature in blue ink, appearing to read "G Muro".

NAME: Griselda Muro
TITLE: Community Mgr

Total # of Images: 0