



**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>DOVID OVED RETREAT CENTER</b>		REINSPECTION DATE <b>Not Specified</b>	INSPECTOR <b>Dawn LaFlower</b>	DATE <b>7/11/2016</b>
LOCATION <b>3500 SEYMOUR RD, RUNNING SPRINGS, CA 92382</b>		PERMIT EXPIRATION <b>5/31/2017</b>	IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN <b>2:35 PM</b>	TIME OUT <b>3:10 PM</b>	FACILITY ID <b>FA0006928</b>	RELATED ID <b>PR0006528</b>	PE <b>3620</b>
		RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED		

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

**97**  
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

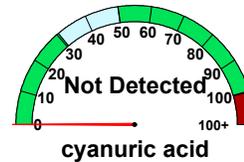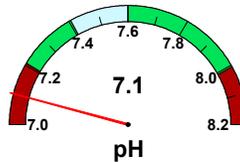

temperature (°F)	No Data
observed flow (gpm)	341
required flow (gpm)	208
volume (gal)	75,000
area (sq ft)	No Data
occupancy	No Data

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K504 Water Quality – Non-Critical – Disinfectant level low**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed free chlorine measuring .86 without cyanuric acid.  Maintain free chlorine measuring 1.0 ppm and not to exceed 10.0 ppm. Corrected to measure 5.0.
	Not In Compliance	
	Violation Reference - HSC - 65529	

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

**36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed pH measuring 7.1.  Maintain pH measuring between 7.2 to 7.8.
	Not In Compliance	
	Violation Reference - HSC - 65530	

**Violation Description:** The pool operator shall maintain public pool water at pH 7.2 to 7.8.

**36K538 Enclosure – Non-Critical – Fencing/Enclosure**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed lateral fence boards of pool enclosure with edges that could allow climbing by small children.  Repair lateral fence boards to lay flat.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

**Violation Description:** The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

**Overall Inspection Comments**

No summary comments have been made for this inspection.



Public Health  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME DOVID OVED RETREAT CENTER	DATE 7/11/2016
LOCATION 3500 SEYMOUR RD, RUNNING SPRINGS, CA 92382	INSPECTOR Dawn LaFlower

**Signature(s) of Acknowledgement**

NAME:

TITLE:

Total # of Images: 0