



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>LA FITNESS</b>		DATE <b>6/10/2015</b>	REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>9/30/2015</b>
LOCATION <b>14485 PIPELINE AV, CHINO HILLS, CA 91709</b>			INSPECTOR <b>Casey Salazar</b>	
MAILING ADDRESS <b>PO BOX 52110, IRVINE CA 92619</b>			IDENTIFIER: Pool	
			SERVICE: 001 - INSPECTION - ROUTINE	
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	
TIME IN <b>9:40 AM</b>	TIME OUT <b>10:30 AM</b>	FACILITY ID <b>FA0000838</b>	RELATED ID <b>PR0015845</b>	PE <b>3620</b>




**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**95**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

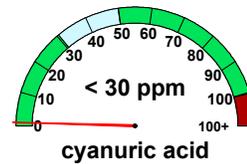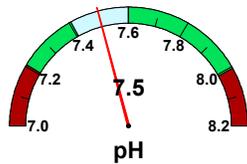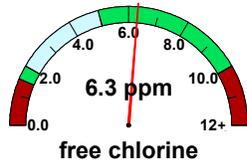

temperature (°F)	82.5
observed flow (gpm)	70
required flow (gpm)	151
volume (gal)	54,400
area (sq ft)	1,849
occupancy	92

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K548 Equipment - General Requirements - System Description**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed sight glass missing from back wash piping system. Provide sight glass after filter.
	Not In Compliance	
	Violation Reference - CCR 24 - 3123B.1	

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The system shall consist of pumps, filters, chemical feeders, skimmers or perimeter overflow systems, valves, pipes, connections, fittings and appurtenances.

**36K556 Equipment – Plumbing labeled**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed incomplete labeling for pool recirculation equipment. Label to indicate direction of flow.
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

**36K560 Equipment – Waste water**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed a discharge pipe/outlet installed before separation tank of backwash line. Backwash line continues from discharge pipe into separation tank and then empties into floor sink. When using DE filters, all waste water must pass through separation tank before discharged.
	Not In Compliance	
	Violation Reference - CCR - 3141B	

Note: Per management, pipes were recently re-done and pipe is supposed to be capped off. Maintenance personnel will be out today to fix piping.

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.



## Public Health

### Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME <b>LA FITNESS</b>	DATE <b>6/10/2015</b>
LOCATION <b>14485 PIPELINE AV, CHINO HILLS, CA 91709</b>	INSPECTOR <b>Casey Salazar</b>

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K562 Skimmers - Pool skimming systems

POINTS <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed weir gates missing from skimmer near containers of pool dumbbells. Provide a weir gate.  Observed tear flap broken/missing from float assembly in skimmer next to handicap pool lift.
	Not In Compliance	
	Violation Reference - CCR - 3136B	

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

#### 36K582 Maintenance - Public pool site maintenance

POINTS <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed handrails at deep end of pool closest to emergency exit to be loose. Tighten hand rails.  Observed an open bag of diatomaceous earth on wet floor in spa pump room. Seal all chemicals to prevent accidental exposure.
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

#### Overall Inspection Comments

Pool inspection conducted.

Operators were unable to determine where pool and spa light switch are located. Unable to test GFCI. Locate light switches and ensure GFCI is operational.

Observed a second pool capacity sign not filled in. Fill in second sign with pool capacity number.

#### Signature(s) of Acknowledgement

NAME:  
TITLE: PIC

Total # of Images: 0