



**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME <b>PLAZA AT SIERRA</b>		REINSPECTION DATE <b>Not Specified</b>	INSPECTOR <b>Lizeth Lopez</b>	DATE <b>9/14/2016</b>
LOCATION <b>16999 ORANGE WY, FONTANA, CA 92335</b>		PERMIT EXPIRATION <b>12/31/2016</b>	IDENTIFIER: Office Spa SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN <b>11:03 AM</b>	TIME OUT <b>11:43 AM</b>	FACILITY ID <b>FA0018709</b>	RELATED ID <b>PR0025167</b>	PE <b>3623</b>
		RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED		

**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

**94**  
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

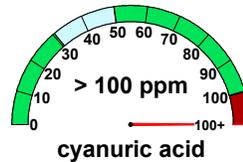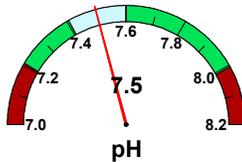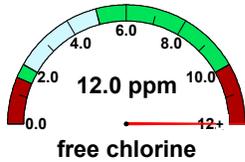

temperature (°F)	100.5
observed flow (gpm)	70
required flow (gpm)	18
volume (gal)	551
area (sq ft)	21
occupancy	10

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K502 Water Quality - Critical – Disinfectant level** **⚠ CRITICAL ⚠**

<b>POINTS</b> <b>5</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed free chlorine concentration to be measured at "[above] range".  Maintain free chlorine concentration between the required range of 3.0 ppm and 10.0 ppm.  Chlorine level was corrected on site to 3.0 ppm.
	Complied on <b>9/14/2016</b>	
	Violation Reference - <b>HSC - 65529</b>	

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

**36K518 Water Quality – Cyanuric acid concentration**

<b>POINTS</b> <b>1</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed cyanuric acid concentration to be measured "[above] range".  Maintain cyanuric acid concentration below the maximum of 100.0 ppm.
	<b>Not In Compliance</b>	
	Violation Reference - <b>HSC - 65530</b>	

**Violation Description:** The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

**Overall Inspection Comments**

Chlorine level was corrected on site to 3.0 ppm.

**Signature(s) of Acknowledgement**



Public Health  
Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)  
[www.SBCounty.gov/dph/dehs](http://www.SBCounty.gov/dph/dehs)

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

<small>FACILITY NAME</small> PLAZA AT SIERRA	<small>DATE</small> 9/14/2016
<small>LOCATION</small> 16999 ORANGE WY, FONTANA, CA 92335	<small>INSPECTOR</small> Lizeth Lopez

SNA

NAME: Signature not available  
TITLE:

Total # of Images: 0