



Public Health
Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME LAKE ARROWHEAD COUNTRY CLUB		DATE 6/30/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION 250 GOLF COURSE RD, LAKE ARROWHEAD, CA 92352			INSPECTOR Patrick Baccari	
MAILING ADDRESS PO BOX 670, LAKE ARROWHEAD CA 92352			IDENTIFIER: Pool	
TIME IN 1:06 PM	TIME OUT 1:51 PM	FACILITY ID FA0007771	RELATED ID PR0013888	PE 3620
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED	

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

98

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$ 4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

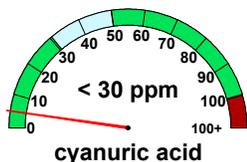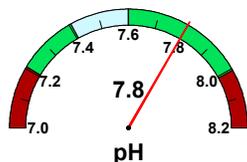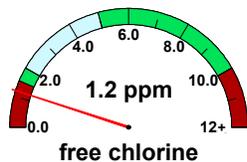

temperature (°F)	83.0
observed flow (gpm)	No Data
required flow (gpm)	166
volume (gal)	80,000
area (sq ft)	No Data
occupancy	90

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:
1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K548 Equipment - General Requirements - System Description

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Connect bond wires to equipment / motors.
	Not In Compliance	
	Violation Reference - CCR 24 - 3123B.1	Repair stuck flow meter.

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The system shall consist of pumps, filters, chemical feeders, skimmers or perimeter overflow systems, valves, pipes, connections, fittings and appurtenances.

36K576 Maintenance – Operation/Incident records

POINTS 1	Compliance Date: Not Specified	Inspector Comments: List daily water chemistry.
	Not In Compliance	
	Violation Reference - HSC - 65523	

Violation Description: The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME: Sierra Dawn Preston
TITLE:



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME LAKE ARROWHEAD COUNTRY CLUB	DATE 6/30/2015
LOCATION 250 GOLF COURSE RD, LAKE ARROWHEAD, CA 92352	INSPECTOR Patrick Baccari

Total # of Images: 0