



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME WIND CREST APARTMENTS		DATE 6/3/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 7/31/2015
LOCATION 933 FAIRWAY DR, COLTON, CA 92324			INSPECTOR John Babalola	
MAILING ADDRESS 933 FAIRWAY DR, COLTON, CA 92324			IDENTIFIER: Pool	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 9:44 AM	TIME OUT 10:47 AM	FACILITY ID FA0004920	RELATED ID PR0015715	PE 3620
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	




**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**93**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

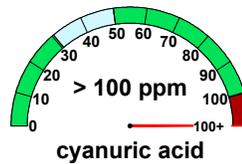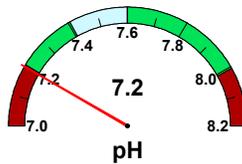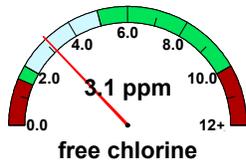

temperature (°F)	No Data
observed flow (gpm)	90
required flow (gpm)	107
volume (gal)	338,813
area (sq ft)	900
occupancy	45

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:  
1. Meet the latest ANSI/APSP-16 performance standard  
2. Be rated for the maximum designed flow-rate of the pump  
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K540 Enclosure – Critical – Gates and doors self-closing and self-latching** ⚠ CRITICAL ⚠

<b>POINTS</b> <b>5</b>	Compliance Date: Not Specified	Inspector Comments: The gate is not self-closing at the time of inspection. Immediately repair the gate to self-close.
	Not In Compliance	
	Violation Reference - CCR - 3119B	Note: Correction is being made.

**Violation Description:** Gates and doors shall be equipped with self-closing and self-latching devices. Gates and doors shall be capable of being locked during times when the pool is closed. The self-latching device shall keep the gate or door securely closed. Gates and doors shall open outwardly away from the pool except where otherwise prohibited by law. The pool enclosure shall have at least one means of egress without a key for emergency purposes. The enclosure shall be constructed so that all persons will be required to pass through common pool enclosure gates or doors in order to gain access to the pool area. All gates and doors exiting the pool area shall open into a public area or a walkway accessible by all patrons of the pool.

**36K518 Water Quality – Cyanuric acid concentration**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: The cyanuric acid level is observed above 100 ppm. Maintain below 100 ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

**Violation Description:** The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

**36K538 Enclosure – Non-Critical – Fencing/Enclosure**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed a tree planted too close to the pool fence. This tree could easily be climbed by the children to jump into the pool enclosure. Remove this tree to prevent children from climbing the fence.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

**Violation Description:** The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME WIND CREST APARTMENTS	DATE 6/3/2015
LOCATION 933 FAIRWAY DR, COLTON, CA 92324	INSPECTOR John Babalola

A handwritten signature in blue ink that reads "Veronica Brommer".

NAME: veronica brommer  
TITLE: leasing specialist

Total # of Images: 0