



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME STARDUST MOBILE HOME COMMUNITY		DATE 5/6/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2015
LOCATION 2250 W MILL ST 104, COLTON, CA 92324			INSPECTOR John Babalola	
MAILING ADDRESS 2250 W MILL ST 104, COLTON, CA 92324			IDENTIFIER: Spa	
TIME IN 10:44 AM	TIME OUT 11:49 AM	FACILITY ID FA0006674	RELATED ID PR0013626	PE 3623
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED	



RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

93
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

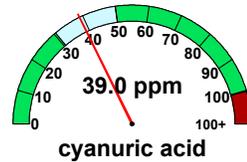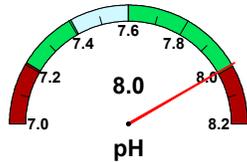

temperature (°F)	100.0
observed flow (gpm)	60
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K502 Water Quality – Critical – Disinfectant level ⚠️ CRITICAL ⚠️

POINTS 5	Compliance Date: Not Specified	Inspector Comments: The free chlorine level is observed at 0.0 ppm (zero) at the time of inspection. Provide at least 3.0 ppm. Note: Correction is being made.
	Not In Compliance	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8

POINTS 1	Compliance Date: Not Specified	Inspector Comments: The pH level is observed at 8.0. Maintain between 7.2 and 7.8. Ideal level is 7.4 - 7.6. Note: Correction is being made.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K538 Enclosure – Non-Critical – Fencing/Enclosure

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed block wall that could be used to climb the fence. Make immediate repairs to prevent easy climbing of the fence. The enclosure shall have a minimum effective perpendicular height of 5 feet.
	Not In Compliance	
	Violation Reference - CCR - 3119B	

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¼ inches (44 mm) measured horizontally.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME STARDUST MOBILE HOME COMMUNITY	DATE 5/6/2015
LOCATION 2250 W MILL ST 104, COLTON, CA 92324	INSPECTOR John Babalola

NAME: Janette Martinez
TITLE: Manager

Total # of Images: 0