



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME YMCA CAMP WHITTLE		DATE 8/6/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION 31701 RIM OF THE WORLD DR, FAWNSKIN, CA 92333			INSPECTOR Sierra Clayborn	
MAILING ADDRESS 625 S NEW HAMPSHIRE AV, LOS ANGELES CA 90005			IDENTIFIER: Pool	
TIME IN 11:58 AM	TIME OUT 1:00 PM	FACILITY ID FA0006890	RELATED ID PR0006584	PE 3620
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



**95**

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

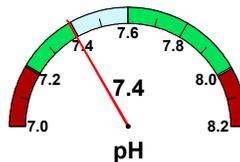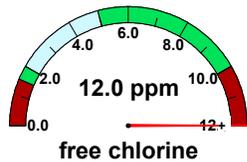

temperature (°F)	84.0
observed flow (gpm)	245
required flow (gpm)	167
volume (gal)	88,000
area (sq ft)	2,600
occupancy	131

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K995 Permit - Suspension** ⚠ CRITICAL ⚠

<b>POINTS</b> <b>NA</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Pool permit suspended due to excessive disinfectant level.
	Not In Compliance	
	Violation Reference - HSC	

**Violation Description:** Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

**36K502 Water Quality - Critical – Disinfectant level** ⚠ CRITICAL ⚠

<b>POINTS</b> <b>5</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed free chlorine exceeding 10ppm.  Maintain pool free chlorine between 2.0ppm and 10ppm when using cyanuric acid. Maintain pool free chlorine between 1.0ppm and 10ppm when not using cyanuric acid.
	Not In Compliance	
	Violation Reference - HSC - 65529	

\*NOTE: An attempt to correct chlorine level during inspection was made though it was unsuccessful. Pool will be closed until free chlorine can be corrected to appropriate levels.

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm<sup>2</sup> by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm<sup>2</sup> the operator shall close the spray ground and water features.

**Overall Inspection Comments**



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME YMCA CAMP WHITTLE	DATE 8/6/2015
LOCATION 31701 RIM OF THE WORLD DR, FAWNSKIN, CA 92333	INSPECTOR Sierra Clayborn

\*Cyanuric acid was unable to be measured at the time of inspection due to an insufficient amount of cyanuric acid reagent available.

Will check cyanuric acid level at time of reinspection.

**Signature(s) of Acknowledgement**

NAME: Fernando Sarmiento  
TITLE: Camp Director

Total # of Images: 0