



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

| | | | | | |
|--|---------------------|--------------------------|-------------------------|-------------------------------------|---|
| FACILITY NAME VINE AVENUE APARTMENTS | | | DATE 7/24/2015 | REINSPECTION DATE Not Specified | PERMIT EXPIRATION 8/31/2015 |
| LOCATION 949 N VINE AV, ONTARIO, CA 91762 | | | | INSPECTOR Shannon Johnson | |
| MAILING ADDRESS 1062 SNYDER LN, MONTEREY PARK CA 91754 | | | | IDENTIFIER: Pool | |
| <input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT | | | | SERVICE: 001 - INSPECTION - ROUTINE | |
| TIME IN 2:40 PM | TIME OUT 3:30 PM | FACILITY ID FA0008516 | RELATED ID PR0014969 | PE 3620 | RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU |
| | | | | | ACTION: 03 - REINSPECTION REQUIRED |

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




94

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

| |
|-------------------|
| Ideal |
| In Compliance |
| Not in Compliance |

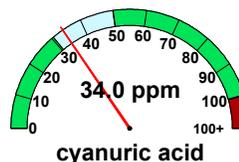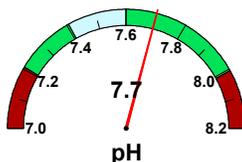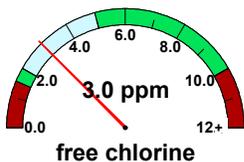

| | |
|---------------------|---------|
| temperature (°F) | 84.0 |
| observed flow (gpm) | No Data |
| required flow (gpm) | 42 |
| volume (gal) | 15,000 |
| area (sq ft) | 380 |
| occupancy | 19 |

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K527 Safety – Safety signs

| | | |
|---------------------------|-----------------------------------|--|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: Observed the safety sign stating "Keep Gate Closed" on the interior side of the SW entrance gate. Place this sign on the exterior side. Observed no safety sign stating this facility's name. The facility's physical address was present. |
| | Not In Compliance | |
| | Violation Reference - CCR - 3120B | |

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with "CAUTION" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."



Public Health Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

| | |
|---|-------------------------------------|
| FACILITY NAME VINE AVENUE APARTMENTS | DATE 7/24/2015 |
| LOCATION 949 N VINE AV, ONTARIO, CA 91762 | INSPECTOR Shannon Johnson |

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K528 Safety – Safety equipment

| | | |
|---------------------------|--|--|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: Observed no life ring available and no body hook on the rescue pool at this pool. |
| | Not In Compliance Violation Reference - HSC - 65540 | |

Violation Description: Except for spray grounds without standing water, the pool operator shall ensure that the following safety and first aid equipment is provided and maintained readily visible and available for use at the public pool at all times:

- (1) A 17-inch-minimum (exterior diameter) life ring with an attached throw rope with a minimum 3/16-inch diameter. The throw rope shall be of sufficient length to span the maximum width of the public pool and shall be stored in such a way as to prevent kinking or fouling.
- (2) A 12-foot-minimum fixed-length rescue pole with a permanently attached body hook. For spas, the length of the rescue pole shall be of sufficient length to effectuate rescue.

For public pools that exceed 75 feet in length or 50 feet in width, the pool operator shall provide a rescue pole and a life ring on at least two opposing sides of the public pool at centralized locations.

For public pools with lifeguard personnel on duty, the pool operator of each public pool area shall have the following additional safety equipment:

- (1) A Red Cross 10-Person Industrial First Aid Kit or the equivalent.
- (2) An operating telephone.
- (3) A backboard and head immobilizer.

36K538 Enclosure – Non-Critical – Fencing/Enclosure

| | | |
|---------------------------|--|---|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: During the last routine inspection conducted at this facility on 6-24-15, it was noted that gaps greater than four inches exist between the bottom of the enclosure and the ground below in multiple locations. No repairs have been completed at this time. A follow up inspection will be conducted to ensure compliance regarding this violation. |
| | Not In Compliance Violation Reference - CCR - 3119B | |

Also, ensure no gaps greater than four inches exist at any place of this enclosure. Some vertical bars were observed to be slightly bent in some locations.

Violation Description: The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch (102 mm) diameter sphere. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children. Chain link may be used, provided that the openings are not greater than 1¾ inches (44 mm) measured horizontally.

36K562 Skimmers - Pool skimming systems

| | | |
|---------------------------|--|--|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: Observed no weir gate within the skimmer. Also, observed no check valve on the equalizer line portion within the skimmer. |
| | Not In Compliance Violation Reference - CCR - 3136B | |

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

36K576 Maintenance – Operation/Incident records

| | | |
|---------------------------|--|--|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: Observed no monthly cyanuric acid reading recorded on the daily records for review. |
| | Not In Compliance Violation Reference - HSC - 65523 | |

Violation Description: The pool operator shall maintain a written daily record of all test results, equipment readings, calibrations, and corrective action taken at the public pool site. [This includes daily records of pH, disinfectant level, and water temperature. If used, cyanuric acid concentration shall be tested monthly.]

If a fecal, vomit, blood contamination, near-drowning, or drowning incident occurs in a pool, the pool operator shall record the incident in accordance with the requirements of [Health and Safety Code] section 65546 and shall identify the affected public pool in the incident record if there is more than one pool at the public pool site. This record shall be maintained at the public pool site.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

| | |
|---|-------------------------------------|
| FACILITY NAME VINE AVENUE APARTMENTS | DATE 7/24/2015 |
| LOCATION 949 N VINE AV, ONTARIO, CA 91762 | INSPECTOR Shannon Johnson |

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K582 Maintenance - Public pool site maintenance

| | | |
|---------------------------|-----------------------------------|---|
| POINTS 1 | Compliance Date: Not Specified | Inspector Comments: Observed the flow meter to be inoperable at this time. |
| | Not In Compliance | |
| | Violation Reference - HSC - 65535 | |

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

A follow up inspection will be conducted on 8-7-15 to ensure no gaps greater than four inches exist between the bottom of this enclosure and the ground below. Failure to gain compliance regarding this matter within that time will result in a charged inspection.

Signature(s) of Acknowledgement

SNC

NAME:
 TITLE:
 Total # of Images: 0